



Exec Aero, LLC · 83 Nilson Way · Orlando, FL 32803 · 407-420-7934 · CRS#: EXAR968D

N850CA**SOCATA, TBM 700, S/N: 552****July 18, 2025**

Cycles: 2156

Hobbs: 2564.7

TTSN: 2899.0

1. C/W Daher standard Inspection Program B Inspection IAW 05-20-03 and 05-20-05.
2. Completed AD compliance research.
3. C/W AD 2025-01-04 (Inner Flap Actuator Drive Nut), Dated 3/11/2025, by Para (g)(1)(ii). Next due 2964.7 or 7/2026.
4. C/W 1Yr Lead-acid check capacity IAW 24-30-04. Capacity check 91.8%.
5. C/W 1Yr Electro-mechanical generator filter cleanliness check IAW 32-35-01 Installed P/N 7423060406 - Hydraulic Screen O-Ring (MS28778-6) Rev/Lot: 73068.
6. C/W 1Yr Chip detectors do an operational test IAW 79-20-02. Installed (2) P/N 7423510012 - Pratt & Whitney Seal (AS3209-115) Rev/Lot: 0080529737.
7. C/W 1Yr Mechanical Standby Instrument Filter check for cleanliness and condition IAW 37-10-06.
8. C/W 600Hr Freon Compressor Belt - Liebherr- replacement IAW 21-55-01 Installed P/N 6046297261 (Alt 20286-30) - BELT: COMPRESSOR Rev/Lot: 24005.
9. C/W 600Hr Alternator belt replacement IAW 24-30-05. Installed P/N 7133601710 - Belt, alternator Rev/Lot: 1812329.
10. C/W 600Hr Stand by generator check brushes for wear and replaced brush block IAW 24-30-05. Installed P/N ALU3045BS - Brush Holder Assy, Installed (2) P/N AN3H-4A - Undrilled Bolt Drilled Head.
11. C/W 3Yr Hydraulic system replaced hydraulic fluid IAW 32-35-00.
12. C/W 3Yr Brake reservoir replace hydraulic fluid IAW 32-40-07.
13. C/W 3Yr Shimmy Damper replace hydraulic fluid IAW 32-20-03.
14. Replaced L/H tire IAW 32-40-01 Removed P/N 033-631-0 - 18x5.5, 10 ply Michelin S/N: 0291S00481, Installed P/N 033-631-0 - 18x5.5, 10 ply Michelin S/N: 4304T00215, Installed P/N MS28775-261 - O RING Rev/Lot: 0020135625, Installed (2) P/N M83461/1-145 - O-Ring Rev/Lot: 71739.
15. Replaced R/H tire IAW 32-40-01 Removed P/N 033-631-0 - 18x5.5, 10 ply Michelin S/N: 0219S00479, Installed P/N 033-631-0 - 18x5.5, 10 ply Michelin S/N: 4305T00203, Installed P/N MS28775-261 - O RING Rev/Lot: 0020135625, Installed (2) P/N M83461/1-145 - O-Ring Rev/Lot: 71739.
16. Replaced fuel drain base flange IAW 51-70-01. Installed P/N TB3052115100 - Flange, fuel drain Rev/Lot: TB9/10/20/21/200, Applied P/N PR1422B1/2-6OZ - Fuel Tank Sealant Rev/Lot: 67092583-67526481, Installed P/N 7423210090 - Seal, fuel Rev/Lot: V250318477.
17. Replaced door 311 fastener receptacle IAW 51-40-00. Installed (2) P/N 7736650311 - Receptacle ABS 0368-01.
18. Cleaned and refinished pilots door opening and cleaned door seal IAW 52-12-00. Installed P/N T700B521027910600 - Pilot door seal.
19. Replaced L/H fuel low level sensor IAW 28-40-02. Installed P/N 6039257270 - Low level sensor Rev/Lot: 58-59-62, Installed P/N 7423210090 - Seal, fuel Rev/Lot: V250318477.
20. Replaced R/H aft position light IAW 33-40-05. Installed P/N 34-0428070-64 - Whelen 28v, 25w.
21. Replaced propeller de-ice brushes IAW 30-60-01 Installed (3) P/N 3E2011-1 - Individual Deice Brush.

arateur
en service
verhauler
se

Dates

Dates

wo: RS25-038

Airframe · page 2 of 2



Exec Aero, LLC · 83 Nilson Way · Orlando, FL 32803 · 407-420-7934 · CRS#: EXAR968D

22. Replaced schrader valves in foreword VCS service port. Serviced air conditioning system and performed leak check IAW 21-55-20, 12-15-01, 12-15-02 and 12-15-03. Installed (2) P/N 1361033 (ALT 2211053) - Schrader Valve: ACCI Rev/Lot: 34748-52.
23. Replaced R/H flaps anti chafe tape IAW 57-50-00. Installed (14 ft) P/N PM-T2H - Flap chafe tape 2".
24. Secured upper cowl rivet fastener forward of R/H exhaust stub using standard practices IAW 51-40-00.
25. Replaced GPU Placard IAW 11-00-00. Installed P/N T700A112001210200 - GPU label.
26. Replaced card table latch assembly IAW 25-21-06. Installed P/N 24554701 - Latch assembly.
27. Patched right horizontal stabilizer deice boot IAW 30-10-00.
28. Replaced upper cowl fastener and receptacle IAW 20-10-02. Installed P/N 7022130020 - Cam-lock 2545HW03-02TS, Installed P/N 7736650311 - Receptacle ABS 0368-01.
29. Operational and leak checks required.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Exec Aero, LLC under work order: RS25-038.

Nathan Marler for CRS EXAR968D

wo: RS25-045

Airframe · page 1 of 1



Exec Aero, LLC · 83 Nilson Way · Orlando, FL 32803 · 407-420-7934 · CRS#: EXAR968D

N850CA**SOCATA, TBM 700, S/N: 552****August 20, 2025**

Cycles: 2168

Hobbs: 2575.0

TTSN: 2909.3

1. Replaced pilot door seal IAW 52-12-00. Installed P/N CR3243-4-4 - Rivet, Installed P/N T700B521027910 - Pilot door seal.
2. Replaced 3 each sections of sealant on inside of R/H wing fuel tank in area 620 IAW 20-30-01. Installed P/N 7423210090 - Seal, fuel Rev/Lot: V250318477.
3. Replaced 3 each electrical environmental splices at OAT probe, and installed insulation on chafed wire adjacent to the OAT probe IAW TBM wiring diagram manual standard practices 20-10-00.
4. Operational and leak checks completed.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Exec Aero, LLC under work order: RS25-045.

Nathan Marler for CRS EXAR968D