

AIRCRAFT RECORD

Model 930
S/N 850
Reg. # N813GG
Cycles

Atlanta Turbine Management
500 Briscoe Blvd. Ste.201
Lawrenceville, Georgia 30046

Date 6/10/24
AFTT 721.7
Hobbs 721.7
Invoice 7959

- ◆ C/W a B+ annual IAW TBM MM and 14 CFR part 43 appendix D.
- ◆ All AD's in compliance through 2024-11.
- ◆ C/W AD2023-11-12 emergency exit strap gripping was PCW on 4/06/23 by installation of SB 70-304-25 by Daher.
- ◆ C/W SB 70-118R3 Para A,C cleaned and lubed flap drive.
- ◆ C/W SB 70-310-24 Starter gen Bearing replacement. Removed Generator P/N MG94K-1 S/N off 0218. Installed Overhauled starter gen P/N MG94K-1 Rev.A S/N on 0279 by Ametek under Wo# V1527599.
- ◆ C/W ELT Cfr. 91.207(d)3. Battery replacement performed by Meryl Inc. under their WO# N813GG. Battery P/N 452-6504-1. Battery expires October 2028.
- ◆ C/W 12/mo. 200 hr main battery cap check, passed at 98 %.
- ◆ C/W 12 mo. Garmin GSM 86 servo slip check of B35-B38 servos. IAW 22-11-00.
- ◆ C/W 600 hour Stby. gen belt replacement with new P/N 7199280007.
- ◆ C/W 24 mo. portable fire bottle weight check. 4 lb,4 oz. within limits.
- ◆ C/W 3 year hydraulic fluid replacement of main actuators, brakes and shimmy dampener.
- ◆ C/W 3 year compass correlation, updated correction card as needed.
- ◆ C/W 7 year NLG actuator axle attach bolt replacement with new AN 4-11A.
- ◆ Replaced protective fairing tape on Rh lower side with 3M5430-19 tape.
- ◆ Installed missing cabinet attach fittings 3 ea. 1002223 and screw 5150307736.
- ◆ Repaired Velcro attachment on carpeting as needed.
- ◆ Reglued cabin entry step tread as needed.
- ◆ Top charge oxygen system to 1750 PSI as needed.
- ◆ Installed new antenna mounting screws P/N 51202026249 for Comm 2 antenna.
- ◆ Polished windshield light scratches with optica 4 polishing system.
- ◆ Adjusted elevator trim cable tensions and safetied IAW M/M.
- ◆ Adjusted Left and right spoiler cable tension
- ◆ Adjusted elevator stops to book specifications.
- ◆ Cleaned suction relief valve regulator screen of dust.
- ◆ Applied windshield edge seal around frame- work with CS3247B1/2.
- ◆ Continued on next page-----

DAHER

AIRCRAFT RECORD

19

Continued from previous page.

- ◆ Replace nose tire P/N 505T08-1 S/N off 02040299 and installed a new tire MS28775-242.
- ◆ Replaced left and right main tires with new. P/N off 185F03-5 S/N off 12610262 and 13550276.
- ◆ Installed tires P/N 033-631-0 Lh S/N on 3130T00413. Rh S/N on 3130T00423.
- ◆ Replaced 2 lh and 1 rh brake caliper piston seals, MS28775-122 and wiper 107-03100.
- ◆ Replaced one ea. crew mask P/N MC10-02-121 S/N off B159213. S/N on B122310.
- ◆ Replaced Lh main actuator drain line with new P/N 7824340001.
- ◆ Re seated elevator bell crank sleeve bearings and locked with Loctite 641 IAW TBM MM.
- ◆ A post MX flight was performed with good results IAW 5-12-02

This aircraft and or component identified above was repaired and inspected in accordance with current federal air regulations and was found to be airworthy for return to service. Pertinent details are found on file under invoice number.

I certify this **Airframe** has been inspected IAW **Annual Inspection** and found to be in airworthy condition.

James Lee

A&P138745785IA

TBM

SERVICE CENTER

ve